
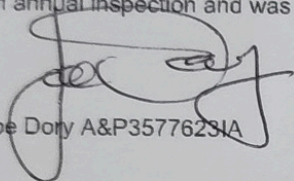


05/09/2026 AIRFRAME. TACH: 1788.5 TTAF:4962.67

Airframe inspected this date per FAR 43 App. D. New battery installed SBSJ16, repaired RH wing tip damage by replacing wing skin PN's: 0523003-57, 0523003-81, 0523003-83 and Rib PN: 0720608-7, See 337 form this date for details, replaced fuel strainer PN: MC0756011-1, overhauled fuel selector valve with FSS-KT-2, replaced L&R fuel drain valves CAV-170, replaced flap control cable MC0510105-93, and MC0510105-94, replaced parking brake pull cable PN: MC0510105-70, replaced trim cables PN's: MC0510105-45 and -44, replaced carb heat cable MCS1230-7, replaced mixture cable MC600-72, RH AFT rudder cable replaced PN: MC0510105-207, wheel bearings cleaned and repacked, 1 wheel bearing replaced RH wheel PN: 13889, all flight controls checked for proper movement and freedom, all pulleys, hinges and bellcranks lubed, all cable tensions checked and set, all interior wing & fuselage surfaces treated with corrosion X, replaced stringer PN: 0512029-4 in cabin roof, ELT removed for battery replacement and placard installed, All AD's C/W this date, see aircraft documents folder for AD compliance records.


Robert Schoepflin A&P3687132 

I certify this aircraft has been inspected in accordance with an annual inspection and was determined to be airworthy.


Joe Dory A&P35776231A

05/09/2026 ENGINE. TACH: 1788.5 TSMOH: 1,258.67

Engine inspected this date per FAR 43 App. D. Compressions over 80 PSI as follows:
(1) 72, (2) 76, (3) 58, (4) 74 (5) 58 (6) 75. Engine serviced with 7qts 20W50 and filter screen inspected, not contaminates noted, oil sample pulled for AV-Labs analysis, spark plugs cleaned and gap checked, timing checked, all cylinders borescoped, no anomalies noted. All AD's Current this date, see aircraft documents folder for AD compliance records.

Robert Schoepflin A&P3687132 

05/09/2026 PROPELLER. TACH 1788.5 TTP: 4962.67

Propeller inspected this date per FAR 43 App. D. Blades dressed and checked for nicks/cracks, propeller removed and painted, new spinner installed PN: U0550236-8, prop bolts torqued and safetied. All AD's current this date, see aircraft documents folder for AD compliance records.

Robert Schoepflin A&P3687132 